

# Manhole Inspection Summary

Manhole # S04I\_\_010MH

Printed On: 6/24/2010

Page 1 of 5

**Inspection** ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **04I** Node: **010** Status: **Found**

Insp Date: **3/23/09 2:25 PM**

Incomplete Comments

Crew: **SD,WJ,JD**  
Inspector: **Lamont**  
Firm: **URS**

**Location** Address: **5100 BROOK GREEN RD**

Cross Street: **DRURY LANE**

**Manhole** Type: **Junction**

Location: **Grass**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments **ROOTS AND CHANNEL DEBRIS SHOULD BE REMOVED**

**Cover**

Shape: **Circular**

Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **2** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ Mortar ☒ Roots ☐ Wall

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ Mortar ☒ Roots ☐ Wall

**Bench**

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ Debris

**Steps**

Count: **2** Missing: **0** ☐ Corroded

**Surcharge**

☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present


Location View



GRADE ADJUSTMENT



Defect 2

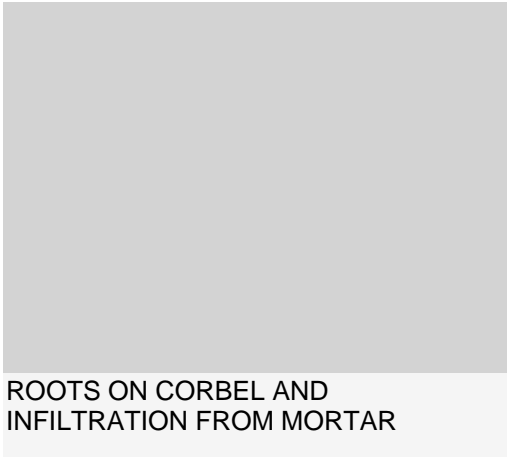

ROOTS ON CORBEL AND  
INFILTRATION FROM MORTAR

Top View




DEBRIS ON BENCH AND CHANNEL

Defect 1




ROOTS ON I9 PIPE SEAL

Defect 3

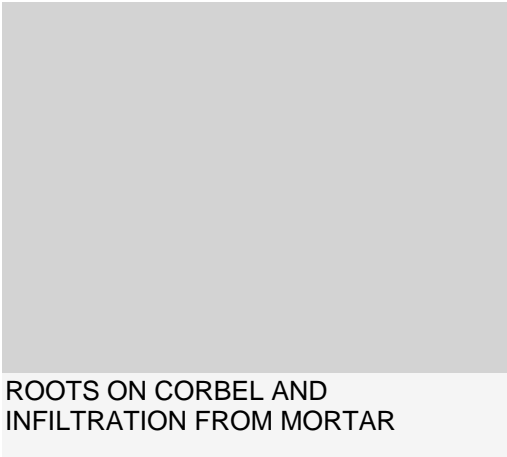

ROOTS ON CORBEL AND  
INFILTRATION FROM MORTAR

### Defect 4



ROOTS ON BARREL WALL AND  
INFILTRATION FROM MORTAR

## Manhole Inspection Summary


Manhole # S04I\_\_010MH

Printed On: 6/24/2010

Page 4 of 5

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



DEBRIS ON BENCH

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **5.70** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer  
Pipe In @ 6 O'Clock

6 O'Clock Inflow



HEAVY CHANNEL DEBRIS

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **5.30** (ft.) Flow Characteristics: **Fast**

Deposits: ☐ None ☐ Mud ☒ Sludge ☒ Debris ☐ Grease

Silt Depth: **5** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

# Manhole Inspection Summary

Manhole # S04I\_\_010MH

Printed On: 6/24/2010

Page 5 of 5

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



PIPE SEAL ROOTS

Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **2.00** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Roots**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection